

INSTALLATION INSTRUCTIONS

P5 Universal Pressure Sensor 0-5/10/25" W.C. Models With Four Selectable Ranges




Versatile probe: remote or duct mount

- RP-6 Remote/duct probe, 6"
- Accepts both 1/8" and 1/4" tubing

PRODUCT APPLICATION LIMITATION:

Senva products are not designed to be used as the lone device for life or safety applications. Senva products are not intended for use in critical applications such as nuclear facilities, human implantable device or life support. Senva believes a systems approach to safety is necessary for these types of applications. Senva is not liable, in whole or in part, for any claims or damages arising from such uses.

DIMENSIONS

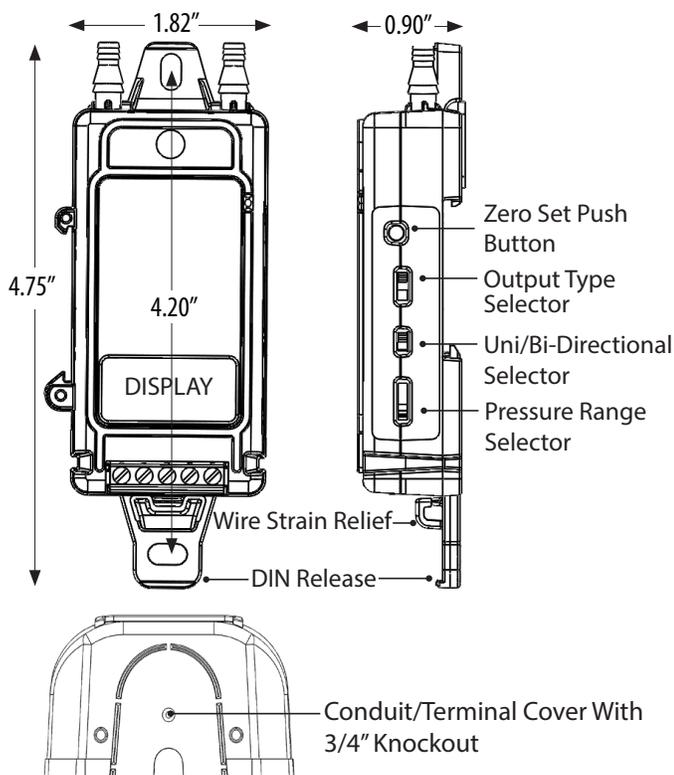

INSTALLATION

1. Screw mount sensor directly to duct, or in panel using self-tapping screws or attach to a DIN rail (2 possible orientations for DIN mounting, BACK and LEFT SIDE).
2. Move slide switch to select appropriate analog output (4-20mA 2-Wire or 3-Wire configurations or 5V/10V)
3. Move slide switch to select desired pressure range and operation mode (Uni or Bi-Directional)
4. Plumb air lines to sensor hose barbs (Accepts 1/8" & 1/4" ID tubing). High (+) and low (-) ports are labeled on the sensor.
5. Wire sensor for voltage or current output as shown in the wiring diagrams. Tighten terminals to 3.5 in-lb.
6. Recommendation: Apply power to sensor. With no pressure applied, press the ZERO SET button for 2 seconds. (For best results, temporarily connect high and low pressure ports.)

LED STATUS/INDICATION

LED indicator will flash every 5 seconds for normal operation.

LED indicator will rapidly flash when applied pressure greater than 110% of selected range.

LED indicator will rapidly flash momentarily when zeroing process is complete.

IMPORTANT!

IMPORTANT WARNINGS

- Only qualified trade installers should install this product
- This product is not intended for life-safety applications
- Do not install in hazardous or classified locations
- The installer is responsible for all applicable codes
- De-energize power supply prior to installation or service
- Forming a "drip-loop" (allowing tubing to dip below the level of the sensor hose barbs) is recommended to protect the sensor from damage caused by condensation.

TROUBLESHOOTING

Symptom	Solution
No output	Check wiring. Ensure power supply meets requirements.
Pressure reading error	Verify control panel software is configured for correct output scaling.
	Verify switch settings.
	Verify tubing is not pinched or leaking.
	Possible contamination. Ensure sensor is used only on dry air or nitrogen.

SPECIFICATIONS


Power Supply	12-30VDC/24VAC(1), 30mA max	
Output type	Selectable outputs	4-20mA loop powered, 4-20 mA 3-wire, 0-5VDC, 0-10VDC
Output scaling	P5-0100	0-1" (Selectable 0.1, 0.25, 0.5, 1.0, ±0.1, ±0.25, ±0.5, ±1.0"WC)
	P5-0500	0-5" (Selectable 0.1, 0.25, 2.5, 5.0, ±0.1, ±0.25, ±2.5, ±5.0"WC)
	P5-0501	0-5" (Selectable 0.5, 1.0, 2.5, 5.0, ±0.5, ±1.0, ±2.5, ±5.0"WC)
	P5-1000	0-10" (selectable 1.0, 2.5, 5.0, 10, ±1.0, ±2.5, ±5.0, ±10"WC)
	P5-2500	0-25" (selectable 5.0, 10, 15, 25, ±5.0, ±10, ±15, ±25"WC)
	P5-1250Pa	0-1250 Pa (selectable 25, 50, 625, 1250, ±25, ±50, ±625, ±1250 Pa)
	P5-2500Pa	0-2500 Pa (selectable 250, 625, 1250, 2500, ±250, ±625, ±1250, ±2500 Pa)
P5-6250Pa	0-6250 Pa (selectable 1250, 2500, 3750, 6250, ±1250, ±2500, ±3750, ±6250 Pa)	
Operating Temperature	Operating range	-4 to 140F (-20 to 60°C)
	Compensated range	-4 to 140F (-20 to 60°C)
Media compatibility	Dry, oil-free air, N2	
Sensor Type	MEMS silicon piezoresistive; precision calibrated	
Sensor Performance	Accuracy	±1.0% of selected range (combined linearity and hysteresis)
	Zero Tolerance	Included in accuracy specification
	Span Tolerance	±1.00%
	Zero Drift (1 year)	0.004"WC/year max. 0.4% for units >0.5"w.c.
	Auto-Zero Input	Push-Button and contact closure
	Thermal Shift (Zero and Span)	0.02% FSO/°C (0.01%FSO/°F) measured from 22°C (72°F)
	Overpressure	up to 5" models: 41.5"w.c.; 10" models: 133"w.c.; 25" models: 332"w.c.
	Max Static Line Pressure	up to 5" models: 41.5"w.c.; 10" models: 133"w.c.; 25" models: 332"w.c.
	Burst Pressure	up to 5" models: 83"w.c.; 10" models: 166"w.c.; 25" models: 415"w.c.
	Position Sensitivity	Non-position sensitive
Auto-zero input	Push-button and N.O. contact closure	
Agency	Compliance	CE, RoHS
Enclosure	Material	UL94 5VB, ABS
	Environmental	NEMA 1

- (1) One side of transformer secondary is connected to signal common. Dedicated transformer is recommended. For 2-wire, use DC only.
 (2) Accuracy includes non-linearity, hysteresis, and repeatability at 70°F.

TYPICAL APPLICATIONS


Velocity: Use a pitot tube and plumb high (+) port to total pressure (Pt) connection and low (-) port to static pressure (Ps) connection to directly read $P_t - P_s = P_v$. Apply correction constant provided by pitot tube manufacturer.

Duct Static: Install a static pressure pickup tube approximately 2/3 of the way down the discharge air duct and plumb to high (+) port for positively pressurized ducts.

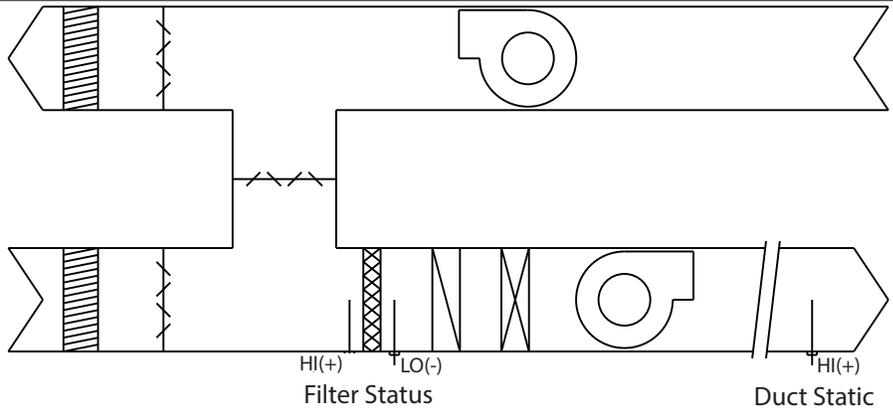


WIRING DIAGRAMS

3 – Wire 4 – 20mA

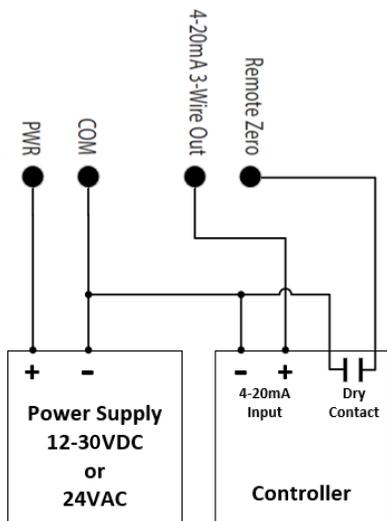

2 – Wire 4 – 20mA

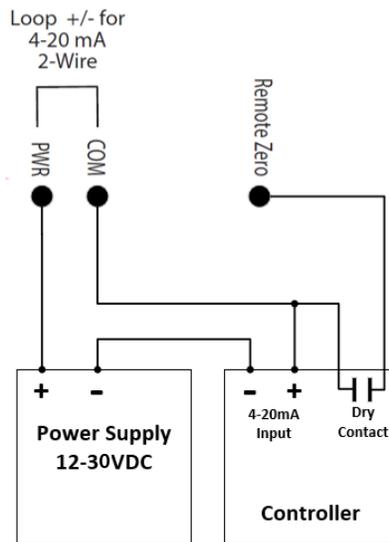

0-5 or 0-10V Selected Output

